

Datasheet

Subject to technical alteration
Issue date: 3/9/2021 • A111



» APPLICATION

Immersion sensor (high temperature) with integrated thermowell pocket for temperature measurement of liquids in duct applications for heating, ventilation and air-conditioning. Also suitable for exhaust systems.

» TYPES AVAILABLE

Immersion sensor temperature – passive

RGS03 <sensor> <xxx>.09

Immersion sensor temperature – active TRV 0..10 V | TRA 4..20 mA

RGS03 TRV MultiRange <xxx>.09

RGS03 TRA MultiRange <xxx>.09

<Sensor>: PT100/PT1000/Ni1000

<xxx>: mounting length 9.84/19.68 in

MultiRange: Measuring ranges adjustable at the transducer

» SECURITY ADVICE – CAUTION



The installation and assembly of electrical equipment should only be performed by authorized personnel.

The product should only be used for the intended application. Unauthorised modifications are prohibited! The product must not be used in relation with any equipment that in case of a failure may threaten, directly or indirectly, human health or life or result in danger to human beings, animals or assets. Ensure all power is disconnected before installing. Do not connect to live/operating equipment.

Please comply with

- Local laws, health & safety regulations, technical standards and regulations
- Condition of the device at the time of installation, to ensure safe installation
- This data sheet and installation manual

» NOTES ON DISPOSAL



As a component of a large-scale fixed installation, Thermokon products are intended to be used permanently as part of a building or a structure at a pre-defined and dedicated location, hence the Waste Electrical and Electronic Act (WEEE) is not applicable. However, most of the products may contain valuable materials that should be recycled and not disposed of as domestic waste. Please note the relevant regulations for local disposal.

» GENERAL REMARKS CONCERNING SENSORS

Especially with regard to passive sensors in 2-wire conductor versions, the wire resistance of the supply wire has to be considered. If necessary the wire resistance has to be compensated by the follow-up electronics. Due to self-heating, the wire current affects the measurement accuracy, so it should not exceed 1 mA. When using lengthy connection wires (depending on the cross section used) the measuring result might be falsified due to a voltage drop at the common GND-wire (caused by the voltage current and the line resistance). In this case, 2 GND-wires must be wired to the sensor - one for supply voltage and one for the measuring current.

Sensing devices with a transducer should always be operated in the middle of the measuring range to avoid deviations at the measuring end points. The ambient temperature of the transducer electronics should be kept constant. The transducers must be operated at a constant supply voltage ($\pm 0,2$ V). When switching the supply voltage on/off, onsite power surges must be avoided.

» BUILD-UP OF SELF-HEATING BY ELECTRICAL DISSIPATIVE POWER

Temperature sensors with electronic components always have a dissipative power, which affects the temperature measurement of the ambient air. The dissipation in active temperature sensors shows a linear increase with rising operating voltage. This dissipative power has to be considered when measuring temperature. In case of a fixed operating voltage ($\pm 0,2$ V) this is normally done by adding or reducing a constant offset value. As Thermokon transducers work with a variable operating voltage, only one operating voltage can be taken into consideration, for reasons of production engineering. Transducers 0..10 V / 4..20 mA have a standard setting at an operating voltage of 24 V =. That means, that at this voltage, the expected measuring error of the output signal will be the least. For other operating voltages, the offset error will be increased by a changing power loss of the sensor electronics. If a re-calibration should become necessary later directly on the sensor, this can be done by means of a trimming potentiometer on the sensor board.

Remark: Occurring draft leads to a better carrying-off of dissipative power at the sensor. Thus temporally limited fluctuations might occur upon temperature measurement.

» PRODUCT TESTING AND CERTIFICATION



Declaration of conformity

The declaration of conformity of the products can be found on our website <https://www.thermokon.de/>.




» TECHNICAL DATA

Measuring values	temperature		
Medium	gases, fluids		
Output voltage (type-dependent)	TRV 1x 0..10 V, min. load 5 kΩ		
Output ampere (type-dependent)	TRA 1x 4..20 mA, max. load 500 Ω		
Output passive (type-dependent)	passive PT1000 PT1000		
Power supply (type-dependent)	TRV 15..35 V = or 15..26 V ~ SELV	TRA 15..24 V = (±10%) SELV	
Power consumption (type-dependent)	TRV typ. 1 W (24 V =) 0,8 VA (24 V ~)	TRA typ. 0,5 W (24 V =)	
Measuring range temp. (type-dependent)	passive +32..+1112 °F		
Output signal range temp. *Scaling analogue output (type-dependent)	TRV TRA TRV6 TRA6: 0..+400 °C, TRV7 TRA7: 0..+600 °C		
Operating temperature range * Max. permissible operating temperature	sensor pocket -58..+320 °F short term max. +600 °C	electronic – TRV TRA -31..+158 °F	electronic - passive -31..+194 °F
Accuracy temperature (type-dependent)	TRV TRA ±0,2 K or ±0,1 % (whatever is greater, typ. at 70 °F)		passive PT100 PT1000: ±0,3 K (typ. at 0 °C, Kl.B)
Sensor (type-dependent)	passive 3-wire		
Enclosure	shape B, aluminium		
Protection	IP66 according to EN 60529		
Cable entry	M20, for wire max. Ø=0.31 in.		
Connection electrical	terminal block, max. AWG 16		
Neck pipe	stainless steel V2A		
Pocket	stainless steel V4A, Ø=9 mm, thread G 1/2", mounting length: 250 500 mm", max. operating pressure 40 bar (580,15 psi)		
Ambient condition	max. 85% rH short term condensation		

» MOUNTING ADVICES

For risk of condensate permeation in the sensor tube respectively in the immersion pocket the bushing must be installed in a position that occurred condensate can run off. Mounting with immersion pocket for usage in liquid media. Use contact fluid for better heat transfer between sensor and measuring medium.

» CONNECTION PLAN

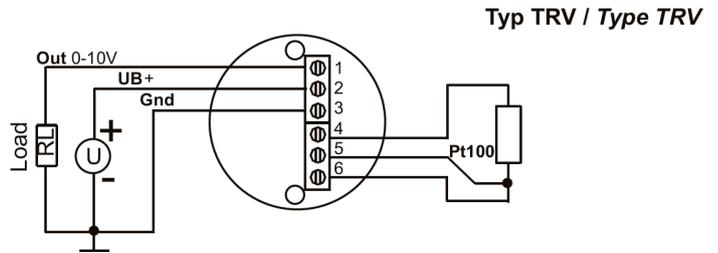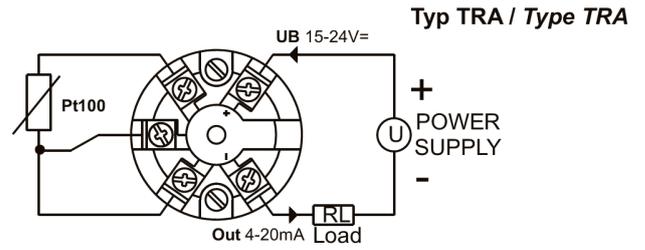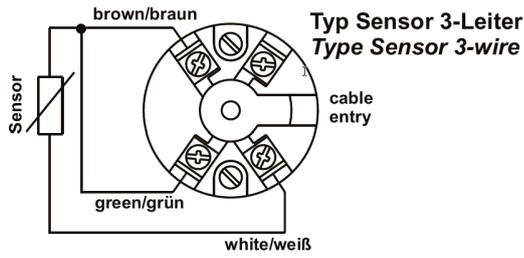

» DIMENSIONS (IN.)

